

SNS COLLEGE OF ENGINEERING

Kurumbapalayam (Po), Coimbatore - 641 107

An Autonomous Institution

Accredited by NBA – AICTE and Accredited by NAAC – UGC with 'A' Grade Approved by AICTE, New Delhi & Affiliated to Anna University, Chennai



COURSE NAME: 23EEB201-THEORY OF DC MACHINES AND TRANSFORMER

II YEAR /II SEMESTER

Unit 4:

Topic: Transformer







TRANSFORMER














CONSTRUCTION OF TRANSFORMER



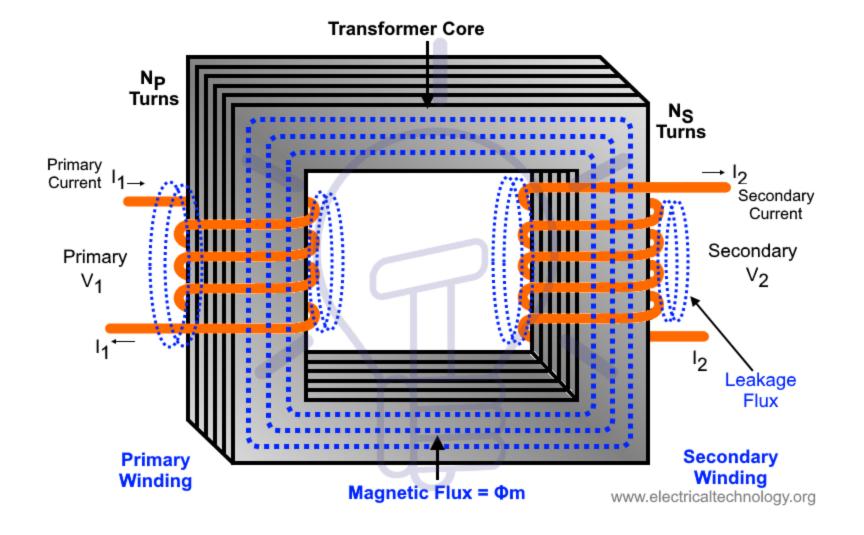








CONSTRUCTION OF TRANSFORMER



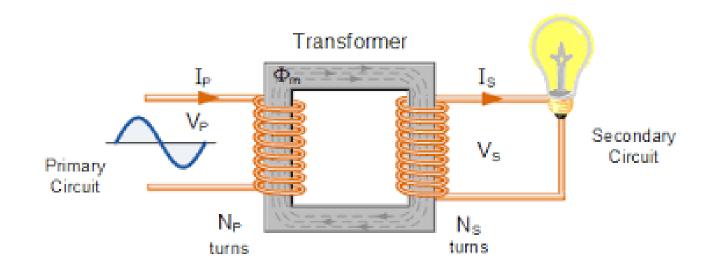









CONSTRUCTION OF STEP UP & STEP DOWN TRANSFORMER



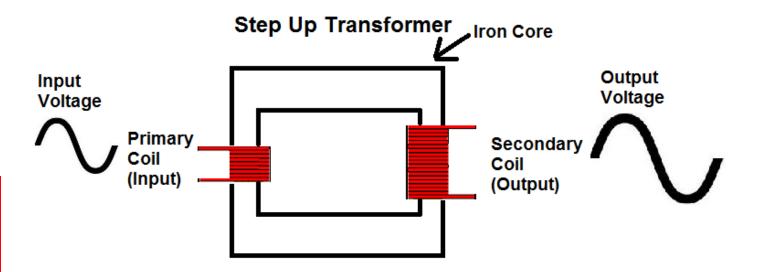

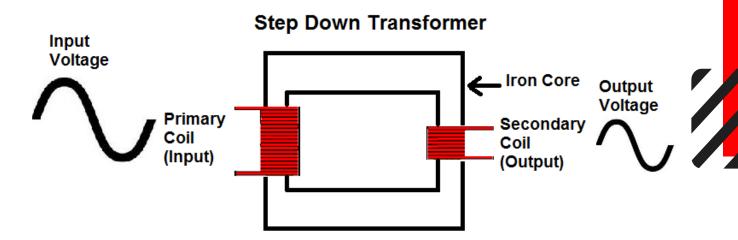



EMF EQUATION OF A TRANSFORMER



If we assume sinusoidal AC voltage, then the magnetic flux can be given by,

$$\phi = \phi_{\rm m} \sin \omega t \cdots (1)$$

Now, according to principle of electromagnetic induction, the instantaneous value of EMF e₁ induced in the primary winding is given by,

Where,

$$\omega = 2\pi f$$

$$\because -\cos\omega t = \sin\left(\omega t - 90^{\circ}\right)$$

Therefore,

$$e_1 = 2\phi f N_1 \phi_m \sin(\omega t - 90^\circ) \cdots (2)$$

Equation (2) may be written as,







$$e_1 = E_{m_1} \sin \left(\omega t - 90^{\circ}\right) \cdot \cdot \cdot (3)$$



$$E_{\rm m1} = 2\pi f N_1 \, \phi_m$$

Now, for sinusoidal supply, the RMS value E_1 of the primary winding EMF is given by,

$$E_1 = \frac{E_{m1}}{\sqrt{2}} = \frac{2\pi f N_1 \phi_{m}}{\sqrt{2}}$$

$$\therefore E_1 = 4.44 f \phi_m N_1 \cdots (4)$$

Similarly, the RMS value E_2 of the secondary winding EMF is,

$$E_2 = 4.44 f \phi_m N_2 \cdots (5)$$

In general,

$$E = 4.44 f \phi_m N \cdots (6)$$


Equation (6) is known as EMF equation of a transformer.









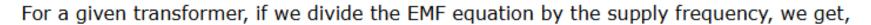

$$rac{E}{f} = 4.44 \, \phi_{
m m} N = {
m Constant}$$

Which means the induced EMF per unit frequency is constant but it is not same on both primary and secondary side of the given transformer.

Also, from equations (4) and (5), we have,

$$\frac{E_1}{E_2} = \frac{N_1}{N_2} \text{ or } \frac{E_1}{N_1} = \frac{E_2}{N_2}$$

Hence, in a transformer, the induced EMF per turn in the primary winding is equal to the induced EMF per turn in the secondary winding.











EFFECT OF RESISTANCE AND LEAKAGE REACTANCE



Transformer Impedance, Resistance & Reactance

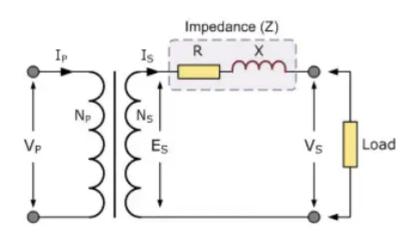

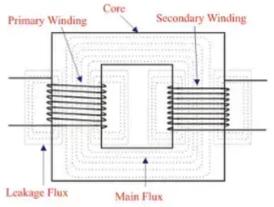







Key learnings:



- •Leakage Reactance Definition: Leakage reactance in a transformer is defined as the self-reactance caused by leakage flux that links either the primary or secondary winding but not both.
- •Transformer Impedance: Impedance of a transformer is the combination of its resistance and leakage reactance, affecting voltage drops in windings.
- •Resistance in Windings: The primary and secondary windings of a transformer, made of copper, possess inherent resistance.
- •Voltage Drops: Voltage drops in transformer windings are due to their impedance, which includes resistance and leakage reactance.
- •Leakage Flux Path: Leakage flux in a transformer passes through the winding insulation and transformer oil, leading to leakage reactance.







Leakage Reactance of Transformer



- In a transformer, not all the flux links both the primary and secondary windings. Some flux links with only one winding, called leakage flux.
- This leakage flux causes self-reactance in the affected winding.
- This self-reactance is also known as **leakage reactance**. When combined with the **transformer's** resistance, it forms impedance.
- This **impedance** causes voltage drops in both the primary and secondary windings.







Resistance of Transformer




The primary and secondary windings of a electrical power transformer are usually made of copper, which is a good conductor of current but not a superconductor. Superconductors are not practically available. Therefore, these windings have some resistance, known collectively as the **transformer's** resistance.

Impedance of Transformer

The both primary and secondary windings will have resistance and leakage reactance. These resistance and reactance will be in combination, is nothing but **impedance of transformer**. If R_1 and R_2 and X_1 and X_2 are primary and secondary resistance and leakage reactance of transformer respectively, then Z_1 and Z_2 impedance of primary and secondary windings are respectively, The Impedance of transformer plays a vital role during parallel operation of transformer.

 $Z_1 = R_1 + jX_1$

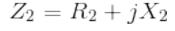






Leakage Flux in Transformer

000

- In an ideal transformer, all the flux would link both the primary and secondary windings.
- However, in reality, not all flux links with both windings.
- Most flux passes through the core of transformer, but some flux links with only one winding.
- This is called leakage flux, which passes through the winding insulation and transformer oil instead of the core.
- Leakage flux causes **leakage reactance** in both primary and secondary windings, known as magnetic leakage.

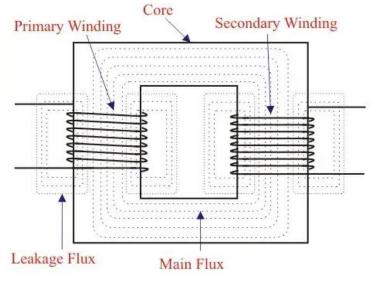







REFERENCES



- 1. Muthusubramanian R, Salivahanan S, "Basic Electrical and Electronics Engineering", Tata McGraw Hill Publishers, (2009) UNIT I V
- 2. Bhattacharya. S.K, "Basic Electrical and Electronics Engineering", Pearson Education, (2017) UNIT I IV
- 3. Mehta V K, Mehta Rohit, "Principles of Electrical Engineering and Electronics", S.Chand & Company Ltd, (2010)- UNIT I and II
- 4. Mehta V K, Mehta Rohit, "Principles of Electronics", S.Chand & Company Ltd, (2005)- UNIT IV and V

THANK YOU

